



HZ-2

	INSL	APMX	S	S1	CW
	(mm)	(mm)	(mm)	(mm)	(mm)
14-14	36.0	8.00	13.90	14.00	14.00
16-16	36.0	9.00	13.90	14.00	16.00
18-18	45.0	12.00	15.90	16.00	18.00
20-20	45.0	13.00	15.90	16.00	20.00

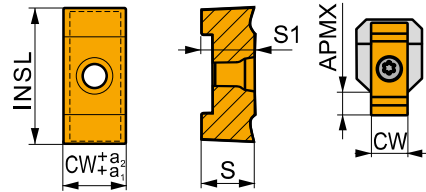

Valores de inicio adecuados para la velocidad de corte (vc) y avance (fz). Consulte nuestra APP Calculadora de mecanizado para obtener más cálculos.

Producto	RE	P		M		K		N		S		H		CW	CWTOLL	CWTOLU
		vc	fz	vc	fz	vc	fz	vc	fz	vc	fz	vc	fz			
	(mm)	(m/min)	(mm/tooth)	(m/min)	(mm/tooth)	(m/min)	(mm/tooth)	(m/min)	(mm/tooth)	(m/min)	(mm/tooth)	(m/min)	(mm/tooth)	(mm)	(mm)	(mm)



Geometría positiva para brochado (dos filos de corte).

HZ/2 14-14 C11	333TN	—	50	0.10	30	0.09	45	0.10	—	—	—	—	—	14.00	0.10	0.21
HZ/2 14-14 H7	333TN	—	50	0.10	30	0.09	45	0.10	—	—	—	—	—	14.00	0.00	0.02
HZ/2 14-14 P9	333TN	—	50	0.10	30	0.09	45	0.10	—	—	—	—	—	14.00	-0.06	-0.02
HZ/2 16-16 C11	333TN	—	50	0.10	30	0.09	45	0.10	—	—	—	—	—	16.00	0.10	0.21
HZ/2 16-16 H7	333TN	—	50	0.10	30	0.09	45	0.10	—	—	—	—	—	16.00	0.00	0.02
HZ/2 16-16 P9	333TN	—	50	0.10	30	0.09	45	0.10	—	—	—	—	—	16.00	-0.06	-0.02
HZ/2 18-18 C11	333TN	—	50	0.10	30	0.09	45	0.10	—	—	—	—	—	18.00	0.10	0.21
HZ/2 18-18 H7	333TN	—	50	0.10	30	0.09	45	0.10	—	—	—	—	—	18.00	0.00	0.02
HZ/2 18-18 P9	333TN	—	50	0.10	30	0.10	45	0.10	—	—	—	—	—	18.00	-0.06	-0.02
HZ/2 20-20 C11	333TN	—	50	0.10	30	0.09	45	0.10	—	—	—	—	—	20.00	0.11	0.24
HZ/2 20-20 H7	333TN	—	50	0.10	30	0.09	45	0.10	—	—	—	—	—	20.00	0.00	0.02
HZ/2 20-20 P9	333TN	—	50	0.10	30	0.10	45	0.10	—	—	—	—	—	20.00	-0.07	-0.02